

Measure no. V5-CN 65516104-02	Subject G01/G02/G08 - 车门饰件氛围灯发光不同（亮暗不均匀）	
Status date (mm/dd/yy) 4/6/21	Status Accepted	PQM Problem reference 235021910
Date created (mm/dd/yy) 4/6/21	Created by Florian Sturm	Organization V5-CN, CAR
Release date (mm/dd/yy)	Approved by	Dealer release Allow automatic release

Vehicles affected

E series	Engine	Body
G01 G02 G08		
Production period (from/to) (mm/dd/yy)	Comment on production period	Feedback (all cases relating to measure up to) (mm/dd/yy)
/		

Complaint

车门饰件中的光导管发光不同（亮暗不均匀）。
详见附件，图 1。



涉及以下车型和生产：

G08，从生产开始至 2021 年 3 月 18 日

G01/G02，从生产开始至 2021 年 10 月 21 日

带选装配置 4UR 氛围灯

Cause

光导管中有水分。

水分可能由于以下情况进入光导管：

- 用过多的水清洗车门饰件
 - 用过多的水清洗侧窗玻璃
(例如：在车窗贴膜时)
 - 阵雨时未关窗
-

Measure

+++ 对上一个版本的更改：G01 和 G02 已添加。

+++

处理客户投诉时如下进行操作：

1. 拆卸光导管，包括车门饰件盖板（装饰条）。

为此，请注意以下维修手册：

更换前部装饰条 51 41 901 / 更换后部装饰条 51 42 911

2. 从车门饰件盖板上拆下光导管。

3. 清洁光导管和透镜（用压缩空气吹洗并用抹布擦干）并重新检查发光情况。

4. 如果发光在清洗后恢复正常（= 不再有亮暗不均匀的情况）。

-> 重新装配和评估车辆。

如果发光在清洗后仍不正常。

-> 更换光导管。

5. 然后在透镜上粘贴毛毡条（零件号码：51 45 2 353 024）（详见附件，图 2）。

如下裁切毛毡条：

3 mm 宽（提示：每个透镜需要 3 条）。

在粘贴毛毡条时要注意，左右末端边缘的距离要始终为 5 mm（详见附件，图 2）。

注意不要将毛毡条粘贴在光导管上。

2.



最后，装配并重新评估车辆。

结算：

处理和结算要按有效的保修条件进行。

前车门保修时推荐的故障代码：

51 41 04 91 内部装饰条/装饰板/前车门光导管色调不同

后车门保修时推荐的故障代码：

51 42 04 91 内部装饰条/装饰板/后车门光导管色调不同

工时代码和工时数请见 AIR 系统。